

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 1

Item ID: D205-634-041**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Stop *NS2*****Item Name:** Replacement Skidtube with Standard Wearplates Fits LH or RH**Start Date:** 8/17/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 8/24/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:**DAS
21**Approvals:** **Process Plan:** **Date:** **AUG 29 2016****Tooling:****Date:****Run Start *NR1*****QC:** **Date:****SPC (Y/N):****Date:****Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr	Revision Nbr
----------	--------------

D2580-041	G
-----------	---

100

Document Control

0.00

100

DOCUMENT CONTROL

DC

Memo

0.00

Doc.Control -USB or Paperwork

Photocopy D205-634 bluefile & type labels per PPP D205-634-041 CHG005

N/A

DAS
21
9-89

NOV 03 2016

110

BENDING MACHINE - SKIDTUBES

0.02

110

CNC Bend 1

Memo

0.07

CNC Delta 100 Bender

1-Bend as per program D2580.C on CNC Bender and Folio 10

2-Cut tubes as per Dwg. D2580

3- scribe batch# in aft end of tube

16-10-11
[Signature]

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 2

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 8/24/2016 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
120		0.00				1	0	16-10-14	
120									
Skidtubes	Memo	0.21							
Skidtubes	1- Deburr ends and remove bending marks								
	2- Prepare tube for welding as per QSI 004								
130	QC5- Inspect part completeness to step on W/O	0.00				1	0	16-10-17	
130									
QC	Memo	0.00							
Quality Control									

DAS
18
9-89

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 3

Item ID: D205-634-041

Accept

N900040100

Setup Start

NS1

Revision ID:

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Stop ***NS2***

Start Date: 8/17/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/24/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.00

140

Skidtubes

Skidtubes

Memo

0.25

1-Weld step D2576 as per Dwg. D2580 and QSI004
A/R Aluminum Rod

2-Grind welds on step as per Dwg D2580

3-Insert D4202-1 spacer, swage as per QSI002 and trim/ grind flush per QSI002
and dwg. Hold x-bolt with DT9701 Use tube expander 1/2 x 17G to start
expansion and finish with 1/2 x 18G to achieve dwg dimension.4-Drill holes for wearplates using DT 8217 & DT8937 7.40" from most fwd
saddle holes (ref only) Open holes to 19/64", adjust stopper not to hit
web. Debur

5-Drill pilot holes for aft cap using DT 8215 Open holes to 0.208". Debur

6-Drill pilot holes for Tow ring using DT8091, open to .640" and Debur

150

QC10- Inspect visual per QSI004- ground welds

0.00

150

QC

Quality Control

Memo

0.00

DAS
19
9-80DAS
38
9-80
OCT 18 2016

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 4

Item ID: D205-634-041

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/24/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

QC5- Inspect part completeness to step on W/O

0.00

160

QC

Memo

0.00

Quality Control

OCT 18 2016

170

Pressure Wash per QSI005 4.3

0.00

170

HandFinish

Memo

0.09

Hand Finishing

Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch and leave fwd cap out of solution.

180

White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum

0.00

180

Powdercoat

Memo

0.05

Powder Coating

START TIME:
OVEN TEMPERATURE:
FINISH TIME:11:50
320°
12:20

1 16-10-19 35 34 0.09

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QS1042) Approval	
Description Work Order Deviation				Disposition				Completed By	
11-03 11-03 07-0								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : ☐							

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 5

Item ID: D205-634-041**Accept*****N900040100*****Setup Start *NS1*****Revision ID:****Item Name:** Replacement Skidtube with Standard Wearplates Fits LH or RH**Stop *NS2*****Start Date:** 8/17/2016 **Start Qty:** 1.00 ***1*****Cust Item ID:****Required Date:** 8/24/2016 **Req'd Qty:** 1.00 ***1*****Customer:****Reference:****Approvals:** **Process Plan:** _____ **Date:** _____ **Tooling:** _____ **Date:** _____**Run Start *NR1*****QC:** _____ **Date:** _____ **SPC (Y/N):** _____ **Date:** _____**Stop *NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

190

QC3- Inspect Part Finish

0.00

190

QC

Memo

0.00

Quality Control

1x 16/10/19 15
-89

DAS
15
-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 6

Item ID: D205-634-041

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/24/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start

NR1

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop

NR2

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
200		0.00							
200									
HandFinish		0.26							
Hand Finishing	Memo 1-Install inserts & wearplates & Gaskets as per Dwg. D2580. Use a drop of Sikaflex on insert holes before installing wearplates A/R Sikaflex-291 <u>M1135376</u> Sikaflex expire date: <u>16112</u> 2-Coat D2594-3 O' rings with Petroleum Jelly and install on D2594-1 plugs as per Dwg D2580 <u>RTU 598 M1135479 1804</u> 3-Inspect for foreign object per QSI 024 4-Install 2855 Aft Cap as per Dwg D2580 and seal Fwd Step & Aft Cap with Sikaflex. Clean excess adhesive A/R Sikaflex-291 <u>M1135376</u> Sikaflex expire date: <u>16112</u> 5-Wing Walk as per Dwg D2580 and QSI 005 4.4 Batch: <u>M1135510</u>								

1. 1 16/10/20

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER : _____							
Misidentified	☐	Past Due	☐								

Work Order ID 150420

Wednesday, August 24, 2016 11:54:36 AM

150420

Page 7

Item ID: D205-634-041

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016 Start Qty: 1.00

1

Cust Item ID:

Required Date: 8/24/2016 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
210 *210* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo Inspect Aft Cap, Fwd Step and Wing Walk of work to Current Step Inspect for Foreign objects per QSI 024	0.00 0.00				1			DAS 38 9-89 OCT 24 2016
220 *220* Packaging Packaging	Packaging Memo Identify and pack for shipping as per PPPD205-634-041 Location: _____ PPP Rev: _____ PPPI50362	0.00 0.00							DAS 27 9-89 NOV 03 2016
230 *230* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.02							DAS 21 9-89 NOV 03 2016 NOV 03 2016

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval	
Description Work Order Deviation				Disposition					
240 82 20 g									
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 1

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:N 02.08.28 FP was QC5 in Step 27; Added QC5 to Step 30
KJ IPP Rev P 10.02.19
per PAR09-043 EC verified by:DD
IPP Rev. O 06.02.28 Added paperwork EC
IPP Rev:P 07-07-09 SS Wearplates & Gaskets JLM IPP Rev:Q
10.12.01 as per chg003 DD verf:EC IPP REV:R 12.01.23 AS
PER ECN11-684 VERF:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
---------------------------------	------------------------	---------------	-------------	---------------------	------------------	-----------------	--------------------	----------------	-------------	--------------	---------------	----------------	--------

D4202-1

Manufactured

No

140

Each

257.0000

20

20

D4202-1

Spacer

**

16-10-17

Location

Loc Qty

Loc Code

LG001

257

145902

5

147952

252

D2580-1

Manufactured

No

110

Each

2.0000

1

1

D2580-1

205 Bent Tube

**

16-10-11

Location

Loc Qty

Loc Code

LG002

2

148389

2

D2576-3

Manufactured

No

140

Each

48.0000

1

1

D2576-3

Step (Machining Detail)

**

16-10-17

Location

Loc Qty

Loc Code

LG001

48

136730

1

144673

10

148337

37

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 2

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

D2855

Manufactured No

200

Each

6.0000

1

1

D2855

Cap

★★

HL 16/10/19

Location

Loc Qty

Loc Code

FP001

6

B145805

137568

6

AN3-5A

Purchased

No

200

Each

353.0000

2

2

AN3-5A

Bolt

★★

HL 16/10/19

Location

Loc Qty

Loc Code

FP001

157

m133686

2

m134502

155

ST350

196

m135058

196

NAS1149D0332J

Purchased

No

200

Each

1,122.000

2

2

NAS1149D0332.J

Washer

★★

HL 16/10/19

Location

Loc Qty

Loc Code

CA

6

m129682

6

FP001

522

m134848

522

GA

463

m135046

463

ST264

131

m135046

131

Wednesday, August 24, 2016 11:54:35 AM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐			
Design ☐	☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐			
Doc/Data ☐	☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐			
Equip/Tooling ☐	☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐			
Handling/Pre ☐	☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐			
Material ☐	☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐			
Internal Transport ☐	☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐			
Tribal Knowledge ☐	☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐			
LOA ☐	☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐			
Substation ☐	☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐			
Past Expiry Date ☐	☐	Manufacturing Process ☐							
Misidentified ☐	☐	Past Due ☐	OTHER : _____						

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

ALS7-1032-130

AELS8-1032-130

Purchased

No

200

Each

919.0000

50

50

AI S7-1032-130******all 16/10/16

Rivnut

LocationLoc QtyLoc Code

FG

50

M128649

50

FP001

869

M128649

869

x50

AN3C4A

Purchased

No

200

Each

1,584.000

50

50

AN3C4A******all 16/10/16

Bolt

LocationLoc QtyLoc Code

FG

20

122814

20

FP001

964

M133440

7

M134396

41

M134509

6

M134606

29

M134676

44

M134762

106

M134861

13

M135058

644

M135127

22

M135297

52

OVER002

500

M135127

0

M135297

0

M135442

500

x50

ST350

100

M132317

3

M134134

18

M134396

79

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 4

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

NAS1149C0332R

Purchased

No

200

Each

5,204.000

50

50

NAS1149C0332R

WASHER

ll 16/10/19

Location

Loc Qty

Loc Code

FP001

190

m135046

190

GA

141

m133284

141

ST260a

2000

m135408

1000

m135466

1000

ST266

2873

m134736

873

m135274

2000

X50

D3566-13

Manufactured

No

200

Each

14.0000

1

1

D3566-13

Gasket Fwd

ll 16/10/19

Location

Loc Qty

Loc Code

FG

2

98908

2

FP001

12

148070

12

xl

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date :	Step #:	QTY Effective :		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			
				Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 5

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

D3566-5

Manufactured No

200

Each

30.0000

1

1

D3566-5

Gasket Center Aft

**

ll 16/10/19

Location

Loc Qty

Loc Code

FG

2

139236

2

FP001

19

147914

19

FP002

9

148071

9

x1

D3566-1

Manufactured No

200

Each

24.0000

2

2

D3566-1

Gasket Aft / Fwd

**

ll 16/10/19

Location

Loc Qty

Loc Code

FG

8

117012

4

139221

4

FP001

16

139221

4

140819

1

149559

11

B151476

x2

D3564-11

Manufactured No

200

Each

19.0000

1

1

D3564-11

Wearplate Aft

**

ll 16/10/19

Location

Loc Qty

Loc Code

FG

4

77056

4

FP002

15

142836

1

148650

14

x1

Wednesday, August 24, 2016 11:54:35 AM

Shop Packet Print

Page 5

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 			
Description Work Order Deviation				Disposition							
								Completed By			
								Lead hand / Supervisor Approval Verification			
								QC / QA Coordinator Approval			

Root Cause				FAULT CATEGORY							
Environment	☐	No Re-verification	☐	Pressure/Forced	☐	Temperature/Cure	☐	Power Loss/Surge	☐	Positioned Wrong	☐
Design	☐	Operator	☐	Bending	☐	Set-up	☐	Folio/Program	☐	Outside Dimensions	☐
Doc/Data	☐	Offset/Setup	☐	Centre Not Concentric	☐	BOM/Route	☐	Grain	☐	Over/Under tolerance	☐
Equip/Tooling	☐	Supplier	☐	Cracks	☐	Broken/Damage/Defect	☐	Weld	☐	Part Incorrect	☐
Handling/Pre	☐	Training	☐	Crimp/Kink/Ripple/Wave	☐	Inspection Incomplete/Unqualified	☐	Wrong Stock Pulled	☐	Part Lost/Missing	☐
Material	☐	Use for Testing	☐	Cuffs	☐	Contamination	☐	Out of Sequence	☐	Part Moved	☐
Internal Transport	☐	Poor Information	☐	Crushing	☐	Countersink	☐	Off-set	☐	Drawing	☐
Tribal Knowledge	☐	Rushing	☐	Heat Treat	☐	Cut Too Short	☐	Mislabeled	☐	Finish	☐
LOA	☐	Product Improvement	☐	Wave/Twist in Tube	☐	Instructions Incomplete/Unclear	☐	Fit/Function	☐	Misread	☐
Substation	☐	Process Improvement	☐	Marks/Chatter	☐	Drill Holes	☐	Misaligned/off center	☐	Turning Sequence	☐
Past Expiry Date	☐	Manufacturing Process	☐	OTHER :							
Misidentified	☐	Past Due	☐								

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 6

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

D3564-13

Manufactured No

200

Each

23.0000

1

1

D3564-13

Wearpad Fwd

**

all 16/10/16

Location

Loc Qty

Loc Code

FG

2

89044

2

FP001

21

147966

11

148702

10

X1

D3564-9

Manufactured No

200

Each

10.0000

1

1

D3564-9

Wearplate Fwd

**

all 16/10/16

Location

Loc Qty

Loc Code

FG

6

76950

4

88407

2

FP002

4

145843

4

B150310

X1

D3564-5

Manufactured No

200

Each

19.0000

1

1

D3564-5

Wearplate Center

**

all 16/10/16

Location

Loc Qty

Loc Code

FG

3

34806

1

89048

2

FP002

16

147887

16

X1

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Description Work Order Deviation				Disposition							
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misre ☐ Tu ☐									
		OTHER : _____									

Picklist Print

Wednesday, August 24, 2016 11:54:35 AM

Page 7

Work Order ID: 150420

150420

Parent Item: D205-634-041

D205-634-041

Parent Item Name: Replacement Skidtube with Standard Wearplates Fits LH or RH

Start Date: 8/17/2016

Required Date: 8/24/2016

Start Qty: 1.00

Required Qty: 1.00

D2594-3

Manufactured No

200

Each

634.0000

16

16

D2594-3

O-Ring

**

all 16/10/16

Location

Loc Qty

Loc Code

FP001

634

135859

24

138060

2

140770

2

145268

500

147875

106

D2594-1

Manufactured No

200

Each

265.0000

16

16

D2594-1

Plug

**

all 16/10/16

Location

Loc Qty

Loc Code

FP001

265

119830

68

134804

16

146645

141

147564

1

147974

7

42807

25

88922

7

X16

DQA: _____ Date: _____

WORK ORDER NON-CONFORMANCE / UPDATE



QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :				MRB (QSI042) Approval 	
Description Work Order Deviation				Disposition					
								Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	

Root Cause			FAULT CATEGORY		
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐				

LIST OF MATERIALS						PART NUMBER	DESCRIPTION
ITEM	QTY -041	QTY -045	QTY -047	QTY -049			
1	X					D2580-041	SKIDTUBE ASSEMBLY
2		X				D2580-045	SKIDTUBE ASSEMBLY
3			X			D2580-047	SKIDTUBE ASSEMBLY
4				X		D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1		D2500-1-190	EXTRUSION
21			16	16		D2570	BUSHING
22	1	1	1	1		D2576-3	STEP
23		4				D2579	SPACER
24	16	16	8	8		D2594-1	PLUG
25	16	16	8	8		D2594-3	O-RING
26	1	1	1	1		D2596	205 WEB
27	1	1	1	1		D2855	AFT CAP
28	1	1				D3564-5	WEARSHOE
29	1	1				D3564-9	WEARSHOE
30	1	1				D3564-11	WEARSHOE
31	1	1				D3564-13	WEARSHOE
32	2	2				D3566-1	GASKET
33	1	1				D3566-5	GASKET
34	1	1				D3566-13	GASKET
35	20	20	24	24		D4202-1	SPACER
36			1			D4406-041	WEARPLATE ASSEMBLY
37			1			D4406-043	WEARPLATE ASSEMBLY
37				1		D5061-1	FWD WEARPLATE
37				1		D5061-3	AFT WEARPLATE
50	50	50				ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50				AN3C4A	BOLT
52	2	2	2	2		AN3-5A	BOLT
53			8	8		AN4-45A	BOLT
54	50	50				NAS1149C0332R	WASHER (AN960C10L)
55	2	2	2	2		NAS1149D0332J	WASHER (AN960JD10L)
56			8	8		MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2596 WEB POWDER COAT ASSEMBLY (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3 POWDER COAT ASSEMBLY (-045) GREEN SANDTEX (REF 4.3.5.8) PER DART QSI 005 4.3 BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 34.5 lbs
D2580-045 = 34.5 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2596 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241/-291.
- 12) INSERT D2594-1 PLUG C/W D2594-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

RELEASED
2014-04-29

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER

NO 150420 MJS
1608-29


G	ADDED -049, -047 WEIGHT UPDATED PER DSI 9598	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	98.08.26
B	AS MANUFACTURED	DS	96.12.02
A	NEW ISSUE	DS	96.09.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	DS	D2580	SHEET 1 OF 9
APPROVED	DS	TITLE	SCALE
DE APPR.	DS	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR FOR ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

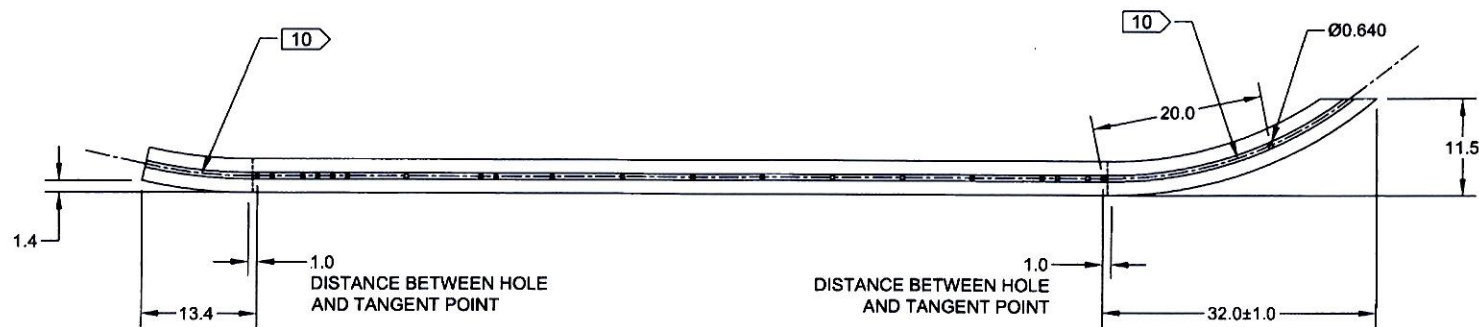

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29


DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 3 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

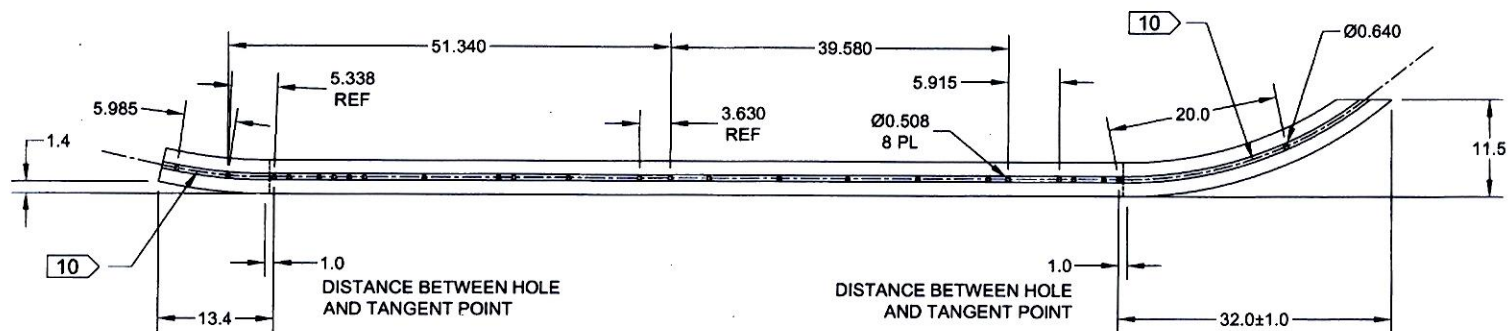

D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)



RELEASED
2014-04-29
Net

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	<i>g.l.</i>	DRAWING NO. D2580	REV. G SHEET 5 OF 9
MFG. APPR.	<i>SA</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
APPROVED	<i>mp</i>	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DE APPR.	<i>mp</i>		
DATE	14.04.09		

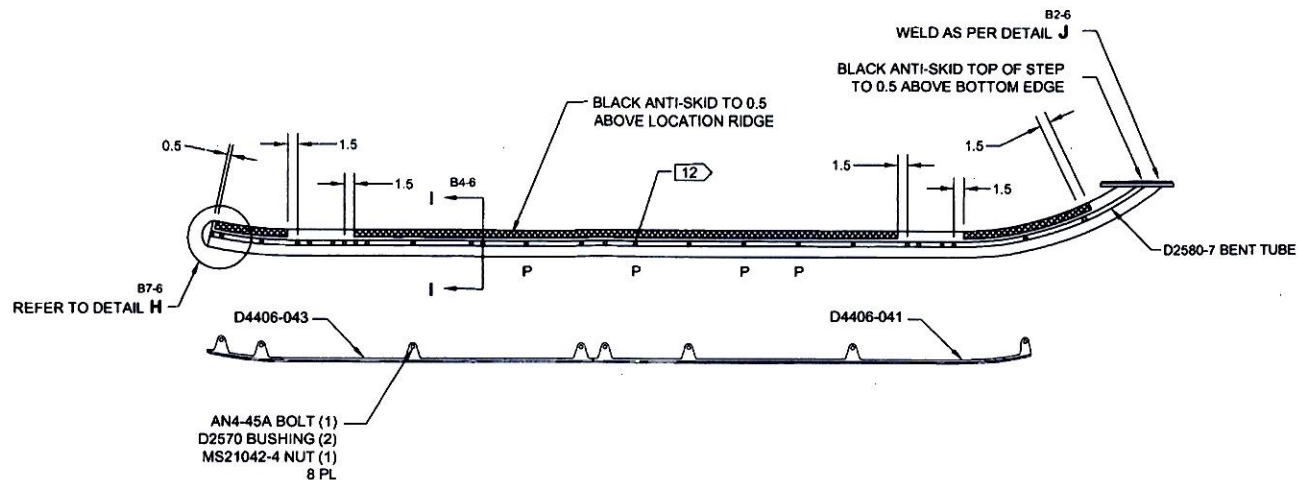


D2580-047 ASSEMBLY DETAIL


RELEASED
2014-04-29

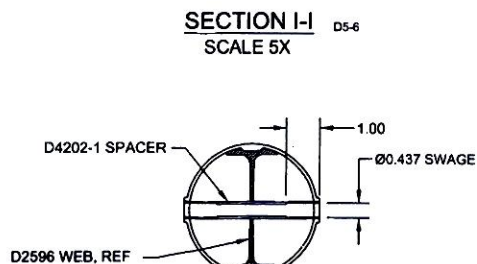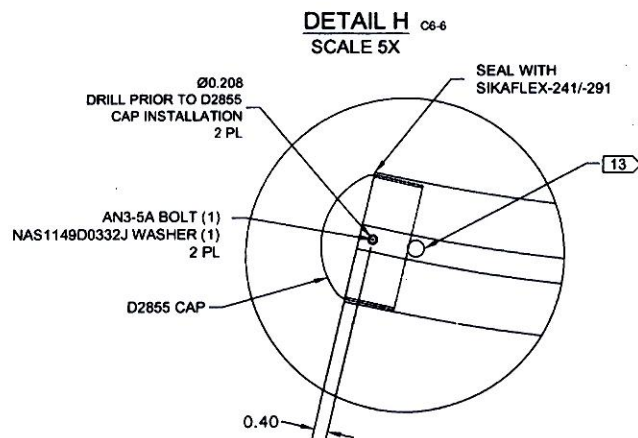

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

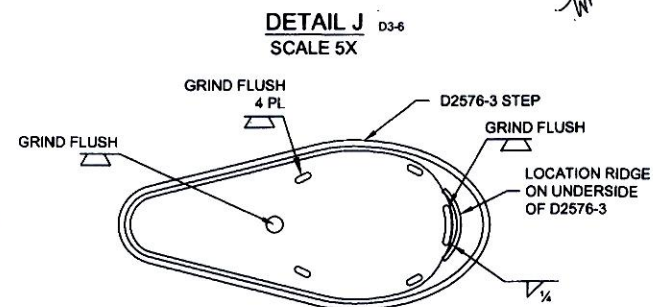


DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 6 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

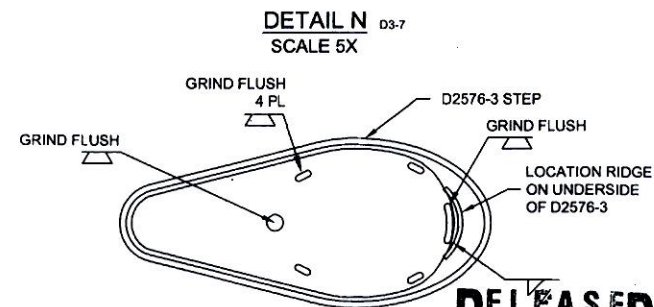

RELEASED
2014-04-29



DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>AJS</i>	DRAWING NO	REV. C
MFG. APPR.	<i>AJS</i>	D2580	SHEET 7 OF 8
APPROVED	<i>AJS</i>	TITLE	SCALE
DE APPR.	<i>AJS</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS THE PROPERTY OF DART AEROSPACE LTD. IT IS NOT TO BE USED FOR ANY PURPOSE OR ON ANY COMMERCE TO ANY OTHER PERSON WITHOUT THE WRITTEN CONSENT OF DART AEROSPACE LTD.	

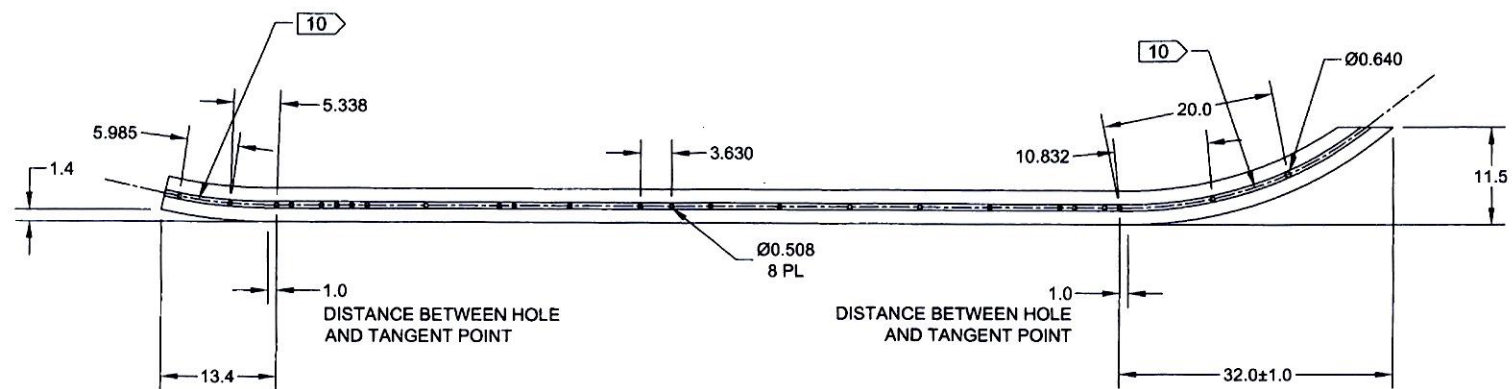

D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)

RELEASED
2014-04-29

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	AJS		
CHECKED	A.P.	DRAWING NO.	REV. G
MFG. APPR.		D2580	SHEET 8 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

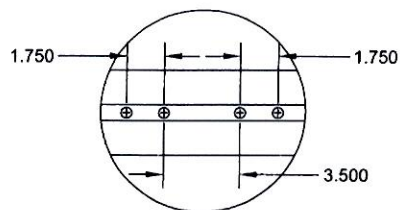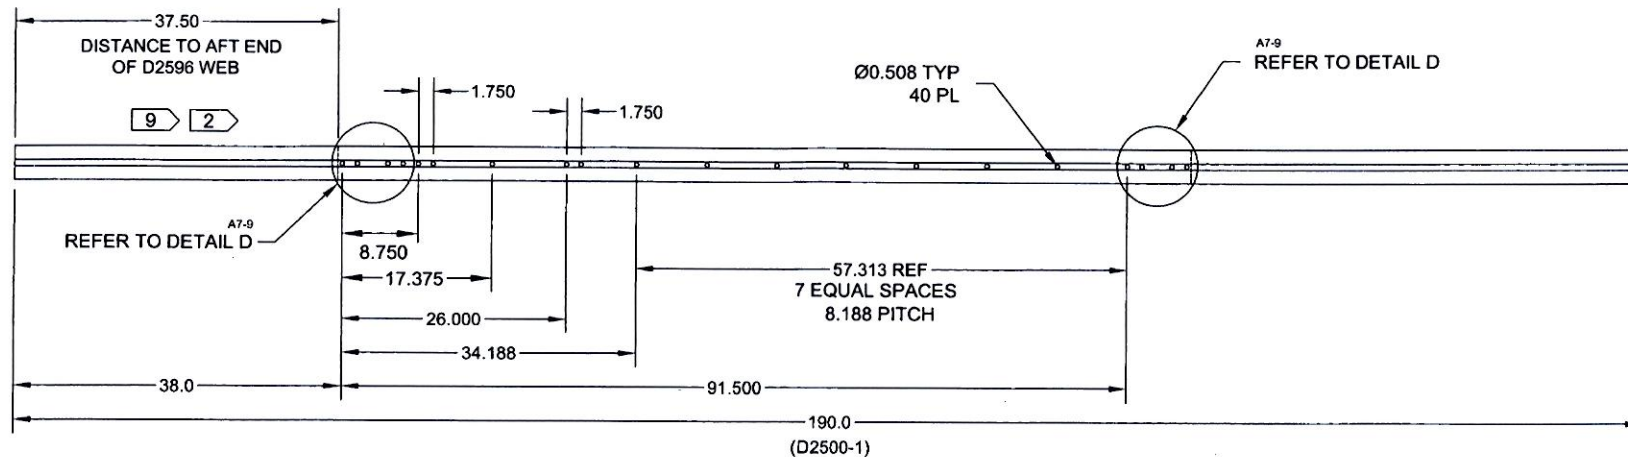

DETAIL D C3-9
SCALE 5X C7-9

D2580-101 TUBE

RELEASED
2014-04-29
WMD

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	AJS	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>A.P.</i>	DRAWING NO.	REV. G
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	14.04.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	